
ASSEMBLY INSTRUCTIONS

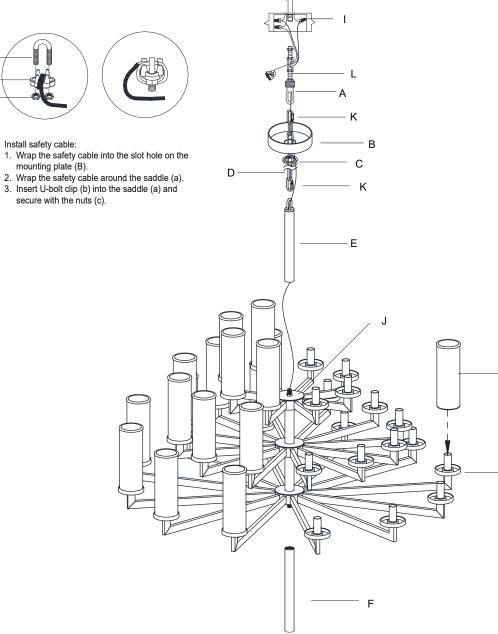

Liaison Triple Tier Chandelier Item# KW 5202

WE RECOMMEND INSTALLATION OF THIS LIGHTING FIXTURE BE DONE BY A LICENSED ELECTRICIAN.

WARNING***SWITCH OFF THE MAIN ELECTRICAL SUPPLY FROM THE MAIN FUSE BOX/CIRCUIT BREAKER BEFORE INSTALLATION. INSPECT ITEM CAREFULLY BEFORE ATTEMPTING TO INSTALL. IF THERE IS ANY DAMAGE OR OBVIOUS DEFECT. DO NOT INSTALL. ITEM MAY NOT BE RETURNED ONCE IT HAS BEEN INSTALLED. NOTE: CAREFULLY UNPACK EACH PIECE IN TOP LAYER OF PACKING PRIOR TO REMOVING. RETAIN ALL PACKING MATERIAL UNTIL INSPECTION AND INSTALLATION ARE FINAL.

1. Carefully remove all parts from the box.


н

G

- 2. Remove the collar loop (A) from the chain (D) by unscrewing the quick link (K).
- A 1/4 IPS pipe must be installed through the junction box and secured to a structural member of the building. This item must hang independently of the junction box. Then install the threaded nipple (L) into the 1/4 IPS PIPE.
- Install the canopy (B) to collar loop (A) and secure with collar ring (C). If needed, adjust collar loop (A) height by loosening hex nuts and screwing collar loop (A) up or down then re-secure.
- 5. Feed the fixture wires and safety cable through the rod (E) and thread the rod (E) to the fixture body (J).
- 6. With the fixture desired height, shorten the chain (D) as needed using the chain pliers (not included).
- Open the chain quick link (K), then attach the chain quick link (K) to the collar loop (A). Secure the chain quick link (K).
- Open the chain quick link (K) from the opposite side then attach to the top hook on the rod (E). Secure the chain quick link (K).
- 9. Weave the fixture wires and safety cables through the chain (D).
- 10. When you reach the canopy (B) and collar loop (A), measure the wires then cut, be certain to leave enough length to connect the wires in the junction box.
- 11. Strip the insulation on the fixture wires about 5/8".
- 12. Loosen the collar ring (C) and let the canopy (B) slip down the chain (D) carefully.
- Twist the fixture wires and safety cables together and push through the center hole of the collar loop (A).

Visual Comfort

ASSEMBLY INSTRUCTIONS

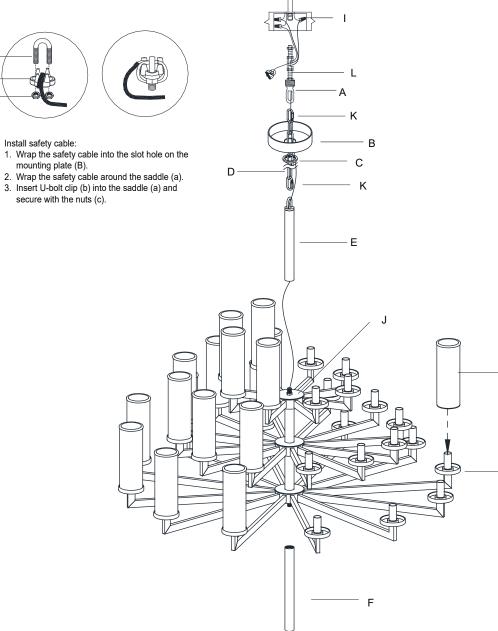

Liaison Triple Tier Chandelier Item# KW 5202

WE RECOMMEND INSTALLATION OF THIS LIGHTING FIXTURE BE DONE BY A LICENSED ELECTRICIAN.

WARNING***SWITCH OFF THE MAIN ELECTRICAL SUPPLY FROM THE MAIN FUSE BOX/CIRCUIT BREAKER BEFORE INSTALLATION. INSPECT ITEM CAREFULLY BEFORE ATTEMPTING TO INSTALL. IF THERE IS ANY DAMAGE OR OBVIOUS DEFECT. DO NOT INSTALL. ITEM MAY NOT BE RETURNED ONCE IT HAS BEEN INSTALLED. NOTE: CAREFULLY UNPACK EACH PIECE IN TOP LAYER OF PACKING PRIOR TO REMOVING. RETAIN ALL PACKING MATERIAL UNTIL INSPECTION AND INSTALLATION ARE FINAL.

- 14. Connect the safety cable as shown in figure.
- Connect the fixture ground wire to the ground wire in the junction box using the wire nut (I).
 IT IS IMPERATIVE THAT THIS FIXTURE BE GROUNDED.
- 16. Connect the fixture ribbed wire (no markings) to the neutral wire in the junction box using the wire nut (I).
- 17. Connect the fixture smooth wire (with markings) to the hot wire in the junction box using the wire nut (I).

DO NOT REVERSE THE HOT AND NEUTRAL CONNECTIONS OTHERWISE SAFETY WILL BE COMPROMISED.

- 18. Carefully tuck the wire connections into the junction box.
- 19. Install the canopy (B) to the junction box and secure with the collar ring (C).
- 20. Insert bulbs (not included) into the sockets.

н

G

- 21. Carefully insert the glass shades (H) to the socket holders (G).
- 22. Thread the rod (F) to the bottom of the fixture body (I).
- 23. Installation is complete, turn on power at fuse or circuit breaker.

***Clean with a dry, soft cloth only. Use no harsh abrasives or chemical agents..

VISUAL COMFORT